



Select to [Benz] > [V-Class/Transporter] > [Sprinter 2006 - Present[W906]]  
> [Diesel engine] > [KI]



Select to [Special function]

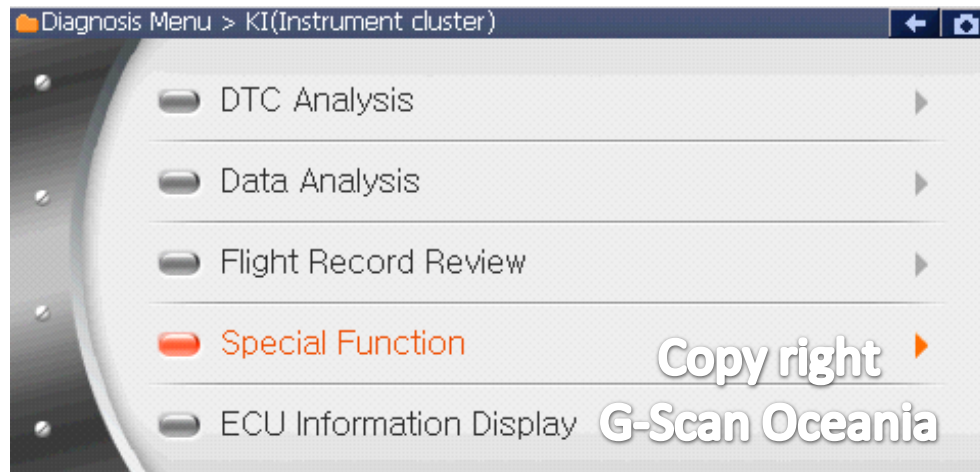

Select to [Reset inadvertently performed oil change]

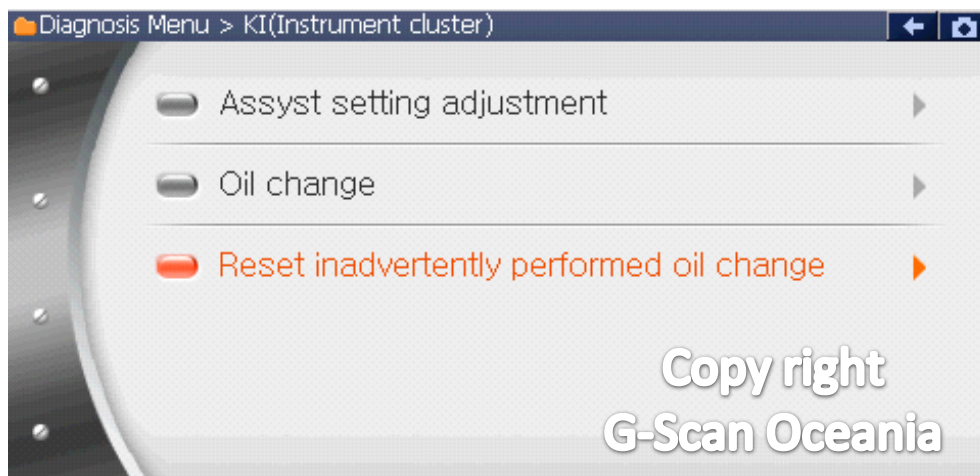

Note 1

