



1. Select [Cruze -> Powertrain -> Transmission control module] menu

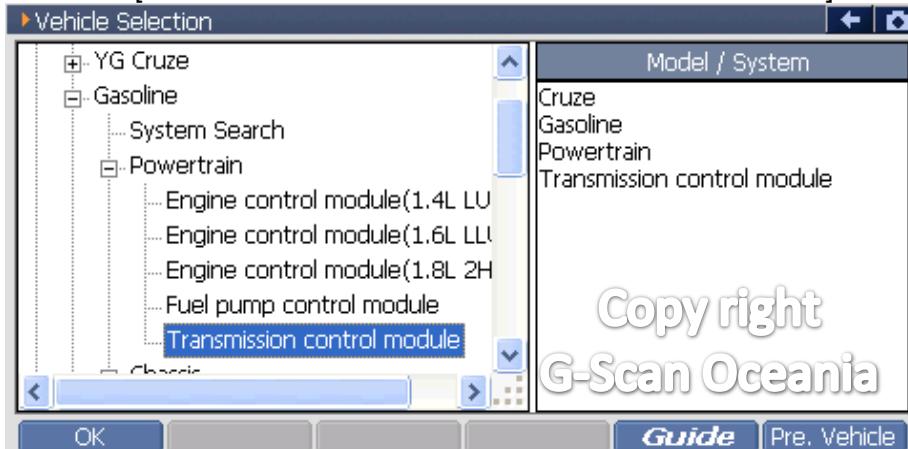

2. Select [Special function]

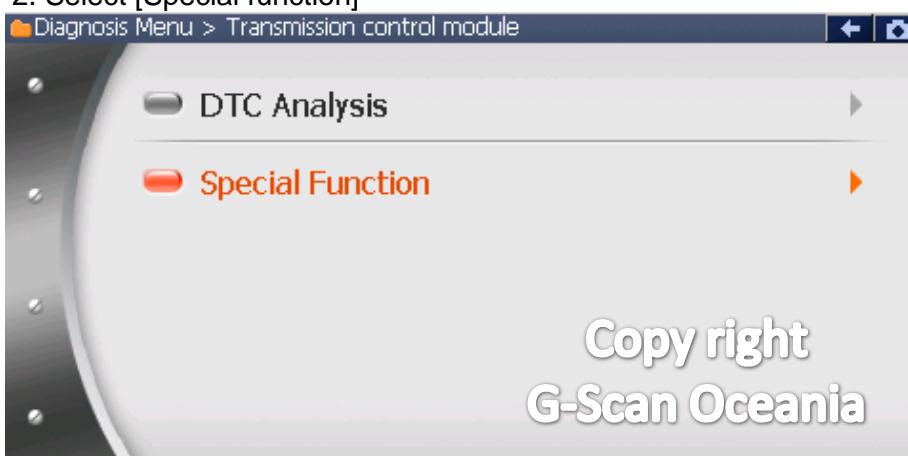

3. Select [Reset TCM Adaption Value]



4. Notice



5. Notice

